

Manhole Inspection Summary

Manhole # S39A__025MH

Printed On: 7/15/2009

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **39A** Node: **025** Status: **Found**

Insp Date: **11/27/07 11:17 AM**

Incomplete Comments

Crew: **1**
Inspector: **jjoiner**
Firm: **ATS**

Location Address: **forrest st**

Cross Street: **old townemall brick walkway**

Manhole Type: **Junction**

Location: **Sidewalk**

Ground Conditions: **Wet**

☐ Prev. Rehab

Weather: **Snow**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **32** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☐ Exists Material:

☐ Parged Height: **0** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Precast Concrete**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Precast Concrete**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☐ Leaks ☒ **Debris**

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **7** Missing: **0** ☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S39A__025MH

Printed On: 7/15/2009

Page 2 of 4


Location View



Top View



Defect 3

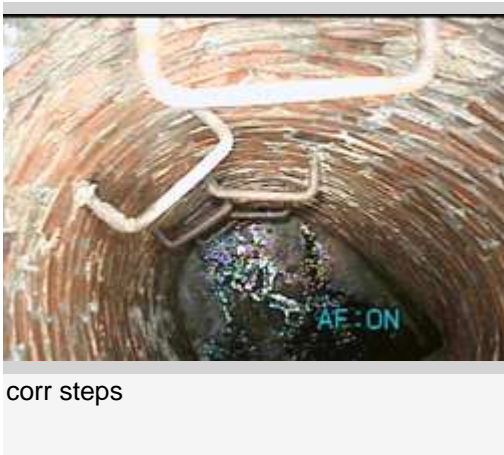

corr steps

Defect 2



bench debris, deteriorating bench

Manhole Inspection Summary

Manhole # S39A__025MH

Printed On: 7/15/2009

Page 3 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



best shot

Pipe Height: 0 (in.) Direct

Pipe Material: Clay ☐ Pipe Lined

Invert Depth: 10.50 (ft.) Flow Characteristics: None

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ Debris ☐ Grease

Silt Depth: 4 (in.) Deposits Extent: Medium

Infiltration: None Pipe Seal Cond: Unknown

Drop: None

Connects To: Manhole

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow



best shot camera cant get close to pipe do to shelf

Pipe Height: 0 (in.) Direct

Pipe Material: Clay ☐ Pipe Lined

Invert Depth: 10.33 (ft.) Flow Characteristics: None

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ Debris ☐ Grease

Silt Depth: 4 (in.) Deposits Extent: Medium

Infiltration: None Pipe Seal Cond: Unknown

Drop: None

Connects To: Connecting Node Not Available

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S39A__025MH

Printed On: 7/15/2009

Page 4 of 4

8 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock



best shot

Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.41** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Connecting Node Not Available**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

8 O'Clock Inflow

Pipe In @ 8 O'Clock



Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.10** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: 4 (in.) Deposits Extent: **Medium**

Infiltration: **None**

Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Connecting Node Not Available**

☐ Possible Illicit Connection